
INSTRUCTIONS & REPAIR PARTS FOR MODELS AC-3CP-MD, AC-3AP-MD, BC-3CP-MD, BC-3AP-MD

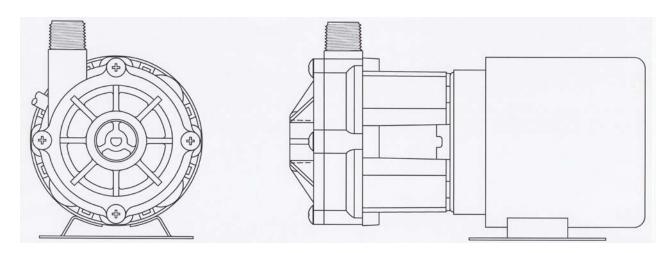

RATINGS AND SPECIFICATIONS

| MODEL | CONNECTORS | | ELECTRICAL | | | G.P.H. AT LISTED HEAD | | | | PSI | MAX | | DIMENSIONS | | PACK | |
|-----------|------------|----------|------------|-------|-------------|-----------------------|-------|-------|--------|--------|------|----------|------------|-----|--------|--------|
| NO. | INLET | OUTLET | HP | WATTS | AMPS | 1 FT. | 3 FT. | 6 FT. | 12 FT. | 18 FT. | GAGE | HEAD | HT. | WD. | LG. | WT. |
| AC-3CP-MD | 3/4" FPT | 1/2" MPT | 1/15 | 150 | 21 | - 630 | 582 | 528 | 390 | 180 | 8.9 | 20.5 FT. | 4-1/4 | 4 | 8-1/8 | 7 lbs. |
| AC-3AP-MD | ¾" OD | 3/4" OD | | | | | | | | | | | | | 8-7/8 | |
| BC-3CP-MD | 3/4" FPT | 1/2" MPT | | 120 | 1.7 | | | | | | | | | | 8-3/4 | 8 lbs. |
| BC-3AP-MD | ¾" OD | 3/4" OD | | | | | | | | | | | | | 9-9/16 | |

PUMP CONSTRUCTION & SERVICING

March "Orbital" Magnetic Drive Pumps eliminate the conventional shaft seals found in most pumps. This means that there is no rotating seal to wear and allow the liquid being pumped to leak out. The pumping action may eventually fail, however the liquid can never leak out. The Model AC & BC-3C-MD have blast cooled, moisture protected motors, with sealed ball bearings, thermal overload protected, allowing the pumps to be run continuously.

All pumps can be serviced with the use of screwdriver. The only moving part in the pump other than the motor, is the impeller-magnet assembly. This assembly rotates on a stationary spindle and up against a thrust washer. These are the only parts that can wear, and may need to be replaced. See the Repair Parts List for replacement parts.

ELECTRICAL & OPERATION

All models are standard in 115 volt, 60 cycle, 1 phase, A.C. The motors are thermal overload protected, and the motor and overload combinations are U.L. and C.S.A. listed. All cord sets are U.L. approved 18/3 wire, SJO or SJT cords.

The AC style pumps have 3 foot long cords with no plug attached.

Pumps are not self priming and will not produce a suction lift and must be installed with a positive flooded suction. We rely on the liquid being pumped to lubricate the impeller-magnet assembly spinning on the stationary spindle. If the pump is run dry for longer than 10 minutes, the plastic may "freeze" onto the spindle. Various bushing materials are available for dry run protection. Contact the factory for your special application.

PUMP MATERIALS

All screws are type 18-8 stainless.

The "O" ring gasket is Buna-N rubber on AC and Viton "A" on BC

The stationary spindle is ceramic.


All plastic parts are Glass Filled Polypropylene Plastic. The thrust washer is ceramic.

The Impeller Magnet is encased in Polypropylene on the BC Model.

Other materials are available, contact the factory for other than standard parts.

www.PumpAgents.com

PumpAgents.com - Click here for Pricing/Ordering

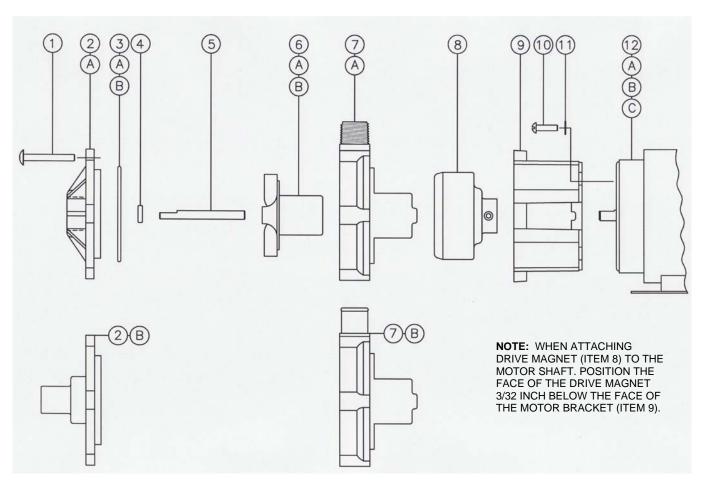

| REPAIR PARTS LIST | | | | | | | | |
|----------------------------|------|---|---|----------------|--|--|--|--|
| USED IN | ITEM | DESCRIPTION | | PART NO. | | | | |
| All | 1 | # 10-32 x 1-1/2 Lg. Rd. Hd. Screw | 4 | 0823-0008-1000 | | | | |
| AC-3CP-MD & BC-3CP-MD | 2a. | Cover (Hsg) ¾" FPT Inlet | 1 | 0130-0021-1000 | | | | |
| AC-3AP-MD & BC-3AP-MD | 2b. | Cover (Hsg) 3/4" OD Inlet | 1 | 0130-0064-1000 | | | | |
| AC-3CP-MD & AC-3AP-MD | 3a. | 2-5/8 I.D. x 3/32 Thick "O" Ring (BUNA N) | 1 | 0130-0011-1000 | | | | |
| BC-3CP-MD & BC-3AP-MD | 3b. | 2-5/8 I.D. x 3/32 Thick "O" Ring (VITON) | 1 | 0130-0033-1000 | | | | |
| All | 4 | Thrust Washer | 1 | 0130-0028-1000 | | | | |
| All | 5 | Impeller Shaft | 1 | 0130-0024-1000 | | | | |
| AC-3CP-MD & AC-3AP-MD | 6a. | Impeller & Magnet Assembly | 1 | 0130-0020-0100 | | | | |
| BC-3CP-MD & BC-3AP-MD | 6b. | Encapsulated Impeller Assembly | 1 | 0130-0069-0200 | | | | |
| AC-3CP-MD & BC-3CP-MD | 7a. | Housing (Rear) ½" MPT Outlet | 1 | 0130-0018-1000 | | | | |
| AC-3AP-MD & BC-3AP-MD | 7b. | Housing (Rear) 3/4" OD Outlet | 1 | 0130-0102-1000 | | | | |
| All | 8 | Drive Magnet Assembly | 1 | 0130-0043-0200 | | | | |
| All | 9 | Motor Connecting Bracket | 1 | 0130-0066-0100 | | | | |
| All | 10 | # 8-32 x 5/8 Lg Rd. Hd. Screw | 4 | 0618-0027-1000 | | | | |
| All 11 | | # 8 Lock Washer | 4 | 0140-0014-1000 | | | | |
| AC-3CP-MD & AC-3AP-MD | 12a. | AC Motor, 115 Volt, 60 Hz | 1 | 0130-0022-1000 | | | | |
| BC-3CP-MD & BC-3AP-MD 12b. | | BC Motor, 115 Volt, 50/60 Hz | 1 | 0130-0140-1000 | | | | |
| All | 12c. | AC or BC Motor, 230 Volt, 50/60 Hz | 1 | 0130-0049-1000 | | | | |

Contact factory for other materials and/or parts not listed.

LIMITED WARRANTY

March pumps are guaranteed only against defects in workmanship or materials for a period of one year from date of manufacture pumping water. On all other solutions, contact the factory for application assistance. March Pump Application Worksheet 0750-0130-1000 is available for additional warranty information.

MARCH MANUFACTURING, INC.

1819 PICKWICK AVE., GLENVIEW, IL 60026-1306, U.S.A

0130-0032-1000 R14